

5/16/2014

Page 1

## **FLORIDA NAUTICAL SURVEYORS.**

**Marine Surveyors & Consultants**

**2727 NE 32<sup>nd</sup> Street  
Fort Lauderdale, FL 33306**

**Tel. (954) 801 2140  
(954) 630 2141  
Fax. (954) 630 8784**

**email: [FNSurveys@aol.com](mailto:FNSurveys@aol.com)  
Web: [www.FloridaNauticalSurveyors.com](http://www.FloridaNauticalSurveyors.com)**

# **SURVEY REPORT**

***"COLUMBO"***

**PREPARED EXCLUSIVELY FOR:**

**SEAKEEPERS SOCIETY**

**CONDUCTED BY:**

**KERRY NIKULA. CMS**

**ACMS. ABYC.**

**FLORIDA NAUTICAL SURVEYORS.**

Marine Surveyors & Consultants  
2727 NE 32<sup>nd</sup> Street  
Fort Lauderdale, FL 33306  
Tel.# (954) 801 2140 or (954) 630 2141  
Fax.# (954) 630 8784

**CONDITION & VALUATION**

Page # 2 of 15.

File #	530PG14
Date:	MAY 15, 2014
Vessel's Name:	"COLUMBO"
Requested By:	SEAKEEPERS SOCIETY
Type:	75' SPORT CRUISERS
Builder:	COLUMBO YACHTS
Model Year:	1996
Year Built:	1996
Power:	TWIN DIESEL
Hull #	CYL75011A696
Doc. #	1156164
Valuation:	760,000 U.S.DOLLARS
Replacement Value:	3,000,000 U.S.DOLLARS
Surveyed By:	KERRY NIKULA CMS - ACMS. ABYC
In Water:	SUNNY ISLES, FLORIDA
Hauled:	NO
Sea Trailed:	NO
In the presence of:	PURCHASER, SELLER CAPTAIN & SURVEYOR

Remarks and Recommendations: PLEASE SEE PAGES 2-15.

The subject vessel at this inspection is deemed to be an acceptable fire and marine risk in its present condition subject to compliance with the 'must' recommendations as reported on page # 14.

## SURVEY REPORT FOR "COLUMBO"

GENERAL				
HAILING PORT:	WILMINGTON, NC. (Sighted on Document not on Transom)			
REGISTERED PORT:	NATIONAL VESSEL DOCUMENTATION CENTER			
L.O.A.: 75' 0"	L.W.L.: *	BEAM: 17' 6"	DRAFT: 4' 0"	DEPTH: 9'
GROSS TONS	73		NET TONS: 59	
DISPLACEMENT:	80,000 LBS. REPORTED		BALLAST: *	
DESIGNER:	SONNY LEVI		BUILDER: COLUMBO YACHTS INC.	
VESSEL USE:	PRIVATE USE ONLY			
NAV. LIMITS:	TO UNDER WRITERS REQUIREMENTS			
VESSELS BERTH:	PRIVATE DOCK		LAID UP: *	
MASTER:	*			
EXPERIENCE/LICENSE	*			
HULL				CONDITION
TOPSIDES:	MOLDED CORED FIBERGLASS, WHITE			GOOD
BOTTOM:	MOLDED CORED FIBERGLASS, BLACK ANTI-FOULING W/BLACK BOOT STRIPE			NOT SIGHTED
SUPERSTRUCTURE:	MOLDED CORED FIBERGLASS, WHITE			GOOD
STEM:	RAKED & FLARED			GOOD
STERN:	TRANSOM			GOOD
FRAMES:	INTEGRAL			GOOD
DECK BEAMS:	INTEGRAL			GOOD
DECKS:	MOLDED CORED FIBERGLASS WITH NONE SKID AREAS			GOOD
KEEL:	FULL			NOT SIGHTED
SKEG:	*			*
ZINCS:	NOT SIGHTED			N/A
THROUGH HULLS:	BRONZE BELOW WATERLINE W/BRONZE & PLASTIC ABOVE			GOOD
BILGES FORWARD:	CLEAN & DRY			GOOD
BILGES AFT:	CLEAN & DRY			GOOD
BILGES ENG. ROOM	CLEAN & DRY			GOOD
BULKHEADS:	CORED FIBERGLASS & PLYWOOD TABBED TO HULL & DECK			GOOD
STERN RAIL:	FIBERGLASS			GOOD
SELF BAILING CP.	*			*
WATERTIGHT COMP.:	*			*
STANCHIONS:	*			*
LIFELINES:	*			*
BOW PULPIT:	*			*
BOW SPRIT:	*			*
DECK HARDWARE:	STAINLESS STEEL & ALUMINUM			GOOD
SWIM PLATFORM:	INTEGRAL FIBERGLASS			GOOD
TRANSOM GATE:	*			*
OTHER:	*			*
OTHER:	*			*

**SURVEY REPORT FOR "COLUMBO"**

<b>EXTERIOR</b>		<b>CONDITION</b>
LIVE WELL	*	*
FISH WELL	*	*
FISH FIGHTING CHAIR	*	*
TACKLE CENTER	*	*
COCKPIT FREEZER	*	*
FISH BOX ICE MAKER	*	*
GUN-WHALE ROD HOLDERS	*	*
ROCKET TYPE ROD HOLDERS	*	*
OUTRIGGERS	*	*
SERVICE AIR COMPRESSOR	FOUR HORNS	GOOD
DIVE AIR COMPRESSOR	BROWNIES	GOOD
COCKPIT ENGINE CONTROLS	*	*
WINDSHIELD WIPERS	REMOVED	SERVICE
WINDSHIELD WASHERS	*	*
FLYBRIDGE REFRIGATOR	*	*
FLYBRIDGE FREEZER	*	*
FLYBRIDGE ICE-MAKER	*	*
AFT DECK REFRIGERATOR	*	*
AFT DECK FREEZER	*	*
AFT DECK ICE-MAKER	*	*
RADAR ARCH	MOUNTED ON HARD TOP	GOOD
MAST:	*	*
FENDERS:	THREE BALL TYPE	GOOD
DOCKING LINES:	NINE DACRON	GOOD
HARD TOP:	YES	GOOD
BIMINI:	*	*
BIMINI FRAME:	*	*
ENCLOSURE:	FULLY ENCLOSED SPORT CRUISER	GOOD
OTHER:	*	*
GROUND TACKLE:	BRUCE W/250' CHAIN	GOOD
GROUND TACKLE:	ABOVE IS APPROX. LENGTH, RUN OUT & CHECK	N/A
GROUND TACKLE:	*	*
OTHER:	*	*
ANCHOR WINDLASS:	MAXWELL 2200 VERTICAL, ELECTRIC	GOOD
DECK WINCHES:	*	*
DINGHY DAVIT:	*	*
GANGWAY:	ALUMINUM	GOOD
PASSARELLE:	*	*
DINGHY:	*	*
OUTBOARD MOTOR:	*	*
OTHER:	*	*
OTHER:	*	*

## SURVEY REPORT FOR "COLUMBO"

ELECTRONICS			CONDITION
	LOWER STATION		
COMPASS:	6" RITCHIE	*	GOOD
AUTOPILOT:	SIMRAD AP26	*	GOOD
RADAR:	FURUNO 48 MILE	*	GOOD
AIS:	*	*	*
GPS.:	GARMIN GPS MAP 3010C	*	GOOD
GPS:	NORTHSTAR 941X	*	GOOD
CHART PLOTTER:	IN ABOVE GPS's	*	GOOD
CHART PLOTTER	*	*	*
VHF:	ICOM IC-M127	*	GOOD
VHF:	*	*	*
HANDHELD VHF'S:	*	*	*
SSB:	*	*	*
HAILER:	*	*	*
CELL PHONE	OWNERS PORTABLE	*	GOOD
SAT. PHONE:	*	*	*
FISHFINDER:	*	*	*
DEPTH FINDER:	LINK + IN GPS	*	GOOD
SONAR:	*	*	*
SPEED LOG:	IN GPS's	*	GOOD
SW. TEMP. GAUGE:	*	*	*
WIND METER:	*	*	*
COMPUTER:	*		*
LAP TOP:	*		*
SOFTWARE:	*		*
OTHER:	*		*
FAX, PRINTER ETC.	*		*
TV. VCR. DVD	SHARP TV IN SALON		INSTALL
TV. VCR. DVD	SHARP TV IN PORT & AFT STATEROOMS		GOOD
TV. VCR. DVD	POWER ACOUSTIK TV IN MASTER STATEROOM		GOOD
TV. VCR. DVD	PANASONIC VCR IN DINETTE		GOOD
TV. VCR. DVD	*		*
OTHER:	*		*
SAT. TV.	*		*
STEREO:	DUAL AM/FM CD PLAYER IN SALON		GOOD
STEREO:	DENON CD STACKER, PANASONIC AM/FM RECEIVER + AUDIOSOURCE EQUILIZER IN DINETTE		GOOD
STEREO:	*		*
OTHER:	*		*
OTHER:	*		*

## SURVEY REPORT FOR "COLUMBO"

FIRE FIGHTING & SAFETY GEAR		CONDITION
HAND EXT'SHER	3 x 2.5 LB., 1 x 5 LB + 1 x 10LB. DRY POWDER	GOOD
INSPECTION DATE:	NO DATE TAG	SERVICE
BUILT IN SYSTEM	2 x "FIREBOY" CLEAN AGENT	GOOD
LOCATION:	TANKS IN ENGINE ROOM	GOOD
INSPECTION DATE:	NO DATE TAG	SERVICE
MANUAL RELEASE:	AFT HELM	GOOD
AUTOMATIC RELEASE:	YES	GOOD
REMOTE INDICATOR:	AT HELM	GOOD
SHUT-DOWNS:	VENT FANS, VENT FLAPS, MAIN ENGINES & GENERATOR	PROVE
AUX. FIRE PUMP:	*	*
MANUAL BILGE P/PS	*	*
EL. BILGE PUMPS	SUBMERSIBLE TYPE	GOOD
ENG. DRIVEN P/PS	*	*
BILGE ALARMS	YES	GOOD
LIFE JACKETS, TYPE "I":	*	*
LIFE JACKETS, TYPE "II"	FIFTEEN ADULT + TWO CHILD	GOOD
LIFE JACKETS, OTHER	*	*
THROW CUSHIONS:	*	*
LIFE RINGS:	ONE RING, NO FLOATING THROW LINES ATTACHED	SERVICE
LIFE RAFTS:	*	*
INSPECTION DATE:	*	*
FLARES, RED HAND HELD:	FOUR	GOOD
DATE OF EXPIRY:	EXPIRED	PURCHASE
FLARES, ORANGE H-HELD:	TWO	GOOD
DATE OF EXPIRY:	EXPIRED	PURCHASE
FLARES, CARTRIDGES:	*	*
DATE OF EXPIRY:	*	*
EPIRB:	*	*
FIRST AID KIT:	YES	GOOD
U.S.C.G. NOTICES	NO PLAQUES SIGHTED	INSTALL
FIRE DETECTORS:	*	*
SMOKE DETECTORS:	YES	GOOD
FUME DETECTORS:	*	*
BELL:	NOT SIGHTED	PURCHASE
HORN:	YES	GOOD
RULES OF THE ROAD BOOK	NOT SIGHTED	PURCHASE
RUNNING LIGHTS:	ALL WORKING	GOOD
ANCHOR LIGHTS:	WORKING	GOOD
SEARCHLIGHTS:	2 x "ACR"	GOOD
SPREADER LIGHTS:	*	*
OTHER:	*	*

## SURVEY REPORT FOR "COLUMBO"

MACHINERY		CONDITION
NO ENGINE SURVEY WAS REQUESTED OR PERFORMED BY THIS SURVEYOR		
ENGINE LOCATION:	MIDSHIPS, BELOW SALON SOLE	GOOD
NUMBER & TYPE:	TWO DIESEL	GOOD
MAKE:	CATERPILLAR	GOOD
PORT MODEL #:	3412	GOOD
STBD. MODEL #:	3412	GOOD
PORT SERIAL #:	3JK00867	GOOD
STBD. SERIAL #:	3JK00871	GOOD
ENGINE HOURS:	PORT: 736 STBD.: 740	N/A
H.P.:	1300 EACH	GOOD
R.P.M.	2300	GOOD
# CYLINDERS:	TWELVE	GOOD
CRUISE SPEED:	34 KNOTS REPORTED	GOOD
MAX. SPEED:	39 KNOTS REPORTED	GOOD
WHEN O/HAULED:	BOTH ENGINES REPLACED IN 2004, REPORTED	N/A
ALARM SYSTEMS:	YES	GOOD
ENGINE BED:	FIBERGLASS STRINGERS WITH FLEXIBLE MOUNTS	GOOD
PAN UNDER ENGINE:	*	*
COOLING SYSTEM:	FRESH WATER	GOOD
VENTILATION:	ADEQUATE	GOOD
FUEL PUMP:	MECHANICAL + ELECTRICAL TRANSFER PUMP	GOOD
FILTERS:	TWIN RACOR BOWLS IN-LINE WITH BOWL ON ENGINES	GOOD
EXHAUST LINE:	HOSE + FIBERGLASS TUBE	GOOD
EXHAUST MUFFLER:	YES	GOOD
SYNCHRONIZER:	YES	GOOD
CONTROLS:	TWIN LEVER MORSE CABLE	GOOD
SHAFT LOG TYPE:	NOT SIGHTED	N/A
BEARINGS:	*	*
STUFFING BOX:	NOT SIGHTED	N/A
PROPELLERS:	NOT SIGHTED	N/A
PROPELLER SHAFTS	STAINLESS STEEL	NOT SIGHTED
STRUTS:	*	*
STRUT BEARINGS:	*	*
PROP: PROTECTION	HULL & KEEL	GOOD
RUDDER	ARNESON SURFACE DRIVES	NOT SIGHTED
RUDDER STUFF BOX	*	*
TRIM TABS:	NOT SIGHTED	N/A
BOWTHRUSTER:	KOOPNAUTIC HYDRAULIC	GOOD
STERN THRUSTER:	*	*
STABILIZERS:	*	*
OTHER:	*	*

## SURVEY REPORT FOR "COLUMBO"

TRANSMISSIONS		CONDITION
TYPE:	ZF	GOOD
MODEL:	BW 190	GOOD
REDUCTION RATIO:	2.030:1	GOOD
PORT SERIAL #:	003468	GOOD
STBD. SERIAL #:	003469	GOOD
TROLLING VALVES:	*	*
STERN OR VEE DRIVES		CONDITION
TYPE:	*	*
MODEL:	*	*
PORT SERIAL #:	*	*
STBD. SERIAL #:	*	*

GENERATORS			CONDITION
AUX. GENERATOR:	ONAN	1152 HOURS	* GOOD
LOCATION:	OUTBOARD OF PORT ENGINE		* GOOD
MODEL #:	LM-307196-0697		* GOOD
SERIAL #:	361PSL1611		* GOOD
KILOWATTS:	32		* GOOD
VOLTAGE:	120/240		* GOOD
NO. CYLINDERS:	FOUR		* GOOD
R.P.M.	1800		* GOOD
COOLING SYSTEM:	FRESH WATER		* GOOD
VENTILATION:	ADEQUATE		* GOOD
EXHAUST LINE	HOSE		* GOOD
EXHUAUST MUFFLER:	AQUALIFT		* GOOD
FUEL PUMP:	MECHANICAL		* GOOD
FILTERS:	RACOR IN-LINE W/BOWL ON ENGINE		* GOOD
OTHER:	*		* *

TRIAL RUN DATA:											
	PORT ENGINE:				STARBOARD ENGINE:						SPEED
	R.P.M.	WATER TEMP.	OIL PRESS	DRIVE OIL	R.P.M.	WATER TEMP.	OIL PRESS.	DRIVE OIL	% LOAD	GPH PER ENG	FROM GPS IN KNOTS
SLOW											
CRUISE											
CRUISE											
CRUISE											
FULL											
SEA TRIAL WAS NOT REQUESTED OR PERFORMED BY THIS SURVEYOR											



## SURVEY REPORT FOR "COLUMBO"

ELECTRICAL		CONDITION
12 VOLT CHARGER	7 AMP SENTRY	GOOD
12 VOLT CHARGER	*	*
24 VOLT CHARGER	40 AMP SENTRY	GOOD
24 VOLT CHARGER	*	*
32 VOLT CHARGER	*	*
DC. CONVERTER	*	*
INVERTER:	TRACE	GOOD
INVERTER CHARGER:	75 AMPS	GOOD
SHORE TRANSFORMERS	YES	GOOD
BATTERY INSTALLATION	6 x 12 VOLT 8D BETWEEN ENGINES	GOOD
BATTERY INSTALLATION	*	*
BATTERY INSTALLATION	*	*
BATTERY INSTALLATION	*	*
BATTERY SWITCHES	FIE APPROVED TYPE	GOOD
DRIP PANS	PLASTIC BOXES WITH LIDS, SECURE	GOOD
CABLE & TERMINAL CONNECTS.	SOUND & SECURE	GOOD
LIGHTS	24 VOLT DC & 110 VOLT AC	GOOD
WIRING	THERMOPLASTIC WHERE SIGHTED	GOOD
125 VOLT SHORE RECEPTACLES	*	*
250 VOLT SHORE RECEPTACLES	TWO x 50 AMP ON POWER REEL	GOOD
PHONE / TV RECEPTACLES	YES	GOOD
30 AMP CABLES	*	*
50 AMP CABLES	TWO x 250 VOLT x 50 FT ON POWER REEL	GOOD
100 AMP CABLES	*	*
PIG TALES	*	*
AC. SWITCHBOARD	IN ENGINE ROOM & SALON	GOOD
DC. SWITCHBOARD	AS ABOVE	GOOD
CIRCUIT BREAKERS	YES	GOOD
LIGHTENING ARRESTER	BONDING SYSTEM	GOOD
OTHER:	*	*
OTHER:	*	*
AIR CONDITIONING SYSTEM	MARINE AIR	GOOD
REVERSE CYCLE HEATING	YES	GOOD
OTHER	*	*
STEERING GEAR	HYDRAULIC	GOOD
OTHER	*	*
OTHER	*	*

**SURVEY REPORT FOR "COLUMBO"**

<b>WATER TANKS</b>		<b>CONDITION</b>
<b>NO. &amp; CAPACITY</b>	ONE, 248 GALLONS, REPORTED	GOOD
<b>SHAPE</b>	RECTANGULAR	GOOD
<b>MATERIALS</b>	STAINLESS STEEL	GOOD
<b>LOCATION</b>	BELOW STATEROO SOLE	GOOD
<b>LOCATION</b>	*	*

<b>FUEL TANKS</b>		<b>CONDITION</b>
<b>NO. &amp; CAPACITY</b>	THREE, 1200 GALLONS, REPORTED	GOOD
<b>SHAPE</b>	RECTANGULAR	GOOD
<b>MATERIALS</b>	ALUMINUM	GOOD
<b>SECURED</b>	YES	GOOD
<b>BONDED</b>	YES	GOOD
<b>LOCATION</b>	250 GALLONS BELOW PORT GUEST SOLE	GOOD
<b>LOCATION</b>	250 GALLONS BELOW STARBOARD STATEROOM SOLE	GOOD
<b>LOCATION</b>	700 GALLONS CENTERLINE	GOOD
<b>LOCATION</b>	*	*
<b>FILLING LINES</b>	HOSE	GOOD
<b>VALVES</b>	BRONZE	GOOD
<b>LOCATION</b>	MANIFOLD	GOOD
<b>VALVE ACCESSIBILITY</b>	GOOD	GOOD
<b>INFLAMMABLES CARRIED</b>	*	*

<b>OIL &amp; GASOLINE</b>		<b>CONDITION</b>
<b>CLEAN ENGINE OIL</b>	*	*
<b>LOCATION</b>	*	*
<b>CLEAN HYDRAULIC OIL</b>	*	*
<b>LOCATION</b>	*	*
<b>DIRTY OIL</b>	*	*
<b>LOCATION</b>	*	*
<b>GASOLINE</b>	*	*
<b>LOCATION</b>	*	*

<b>HOLDING TANKS &amp; TREATMENT SYSTEMS</b>		<b>CONDITION</b>
<b>BLACK WATER TANK</b>	ONE, 78 GALLONS, REPORTED	GOOD
<b>LOCATION</b>	BETWEEN ENGINES	GOOD
<b>BLACK WATER TANK</b>	*	*
<b>LOCATION</b>	*	*
<b>GRAY WATER TANK</b>	SUMPS	GOOD
<b>LOCATION</b>	IN BILGES	GOOD
<b>GRAY WATER TANK</b>	*	*
<b>LOCATION</b>	*	*

**SURVEY REPORT FOR "COLUMBO"**

<b>INTERIOR</b>		<b>CONDITION</b>
<b>NO. OF CABINS</b>	<b>THREE</b>	<b>GOOD</b>
<b>ENCLOSED HEADS</b>	<b>TWO + DAY HEAD</b>	<b>GOOD</b>
<b>INTERIOR FINISH</b>	<b>LEATHER</b>	<b>GOOD</b>
<b>CABIN SOLE</b>	<b>PLYWOOD &amp; FIBERGLASS</b>	<b>GOOD</b>
<b>RUGS, CARPETING</b>	<b>CARPETS THROUGH-OUT</b>	<b>GOOD</b>
<b>TRIM</b>	<b>LEATHER</b>	<b>GOOD</b>
<b>OVERHEAD</b>	<b>LEATHER</b>	<b>GOOD</b>
<b>DINETTE</b>	<b>STARBOARD</b>	<b>GOOD</b>
<b>BUNK CUSHIONS</b>	<b>UPHOLSTERY OVER FOAM MATTRASS'S</b>	<b>GOOD</b>
<b>CURTAINS</b>	*	*
<b>OTHER</b>	*	*
<b>GALLEY</b>		<b>CONDITION</b>
<b>LOCATION</b>	<b>PORT DOWN</b>	<b>GOOD</b>
<b>STOVE</b>	*	*
<b>OVEN</b>	*	*
<b>STOVE TOP</b>	<b>TWO BURNER ELECTRIC "PRINCESS"</b>	<b>GOOD</b>
<b>STOVE SHUT OFF'S</b>	<b>STOVE &amp; SWITCHBOARD</b>	<b>GOOD</b>
<b>BBQ</b>	*	*
<b>MICROWAVE</b>	<b>KITCHENAID</b>	<b>GOOD</b>
<b>CONVECTION OVEN</b>	<b>IN ABOVE</b>	<b>GOOD</b>
<b>VENTILATION</b>	<b>ADEQUATE</b>	<b>GOOD</b>
<b>REFRIGERATOR</b>	<b>FRIGIDAIRE</b>	<b>GOOD</b>
<b>FREEZER</b>	<b>AS ABOVE</b>	<b>GOOD</b>
<b>OTHER REFRIGERATION</b>	*	*
<b>OTHER REFRIGERATION</b>	*	*
<b>ICE-MAKER</b>	<b>U-LINE IN SALON</b>	<b>GOOD</b>
<b>SMALL APPLIANCES</b>	*	*
<b>CENTRAL VACUUM SYSTEM</b>	<b>YES</b>	<b>GOOD</b>
<b>HOT WATER HEATER</b>	<b>10 GALLON, ELECTRIC "GENERAL ELECTRIC"</b>	<b>GOOD</b>
<b>INSTANT WATER HEATER</b>	*	*
<b>WATER MAKER</b>	*	*
<b>WASHER / DRYER</b>	<b>SPLENDIDE COMBI</b>	<b>GOOD</b>
<b>DISHWASHER</b>	*	*
<b>COMPACTOR</b>	*	*
<b>GALLEY COUNTER</b>	<b>CORIAN</b>	<b>GOOD</b>
<b>SHOWER</b>	<b>THREE + DECK SHOWER</b>	<b>GOOD</b>
<b>TUB'S</b>	*	*
<b>JACUZZI'S</b>	*	*
<b>OTHER</b>	*	*
<b>OTHER</b>	*	*

**SURVEY REPORT FOR "COLUMBO"****CONDITION & VALUATION**

<b>OWNERS:</b>	<b>SEAKEEPERS SOCIETY</b>
<b>ADDRESS</b>	<b>355 ALHAMBRA CIRCLE #100</b>
<b>ADDRESS</b>	<b>CORAL GABLES</b>
<b>ADDRESS</b>	<b>FL. 33134</b>
<b>PHONE #</b>	<b>*</b>
<b>PHONE #</b>	<b>410 919 8400</b>
<b>PHONE #</b>	<b>*</b>
<b>FAX #</b>	<b>*</b>
<b>FAX #</b>	<b>*</b>
<b>EMAIL</b>	<b>rsnow@seakeepers.org</b>
<b>EMAIL</b>	<b>*</b>
<b>OTHER</b>	<b>*</b>

<b>BOAT LOCATION</b>	<b>SUNNY ISLES, FLORIDA</b>
<b>HAUL OUT YARD</b>	<b>*</b>
<b>SEA TRIAL LOCATION</b>	<b>*</b>
<b>WEATHER CONDITIONS</b>	<b>*</b>
<b>OTHER</b>	<b>*</b>
<b>ENGINE SURVEYOR</b>	<b>*</b>
<b>LISTING BROKERAGE</b>	<b>*</b>
<b>SELLING BROKERAGE</b>	<b>*</b>
<b>SELLING BROKER</b>	<b>*</b>
<b>CAPTAIN</b>	<b>*</b>
<b>OTHER</b>	<b>*</b>
<b>OTHER</b>	<b>*</b>

Engine survey was not requested or performed by this surveyor. If this is required it is suggested that an engine surveyor be contracted to carry this work out.

**Note:** The tanks were not full at this survey and it is suggested that they be filled to prove integrity.

**Note:** All surveys call for all USCG, NFPA and ABYC deficiencies to be noted and a fair approximate local geographic market valuation to be made.

**Documents:** USCG Documentation sighted.

**SURVEY REPORT FOR "COLUMBO"****CONDITION & VALUATION**

The undersigned places an approximate value of **760,000 U.S. Dollars** on subject yacht "COLUMBO" based on recent selling prices of similar vessels of like type, size, age, manufacture, construction, condition, power and equipment, all fairly depreciated. Also on this surveyors personal knowledge of the local market, BUC book, Yachtworld.com and other material at hand.

This valuation is intended for insurance and valuation purposes only and is not intended to influence the purchase or none purchase of subject vessel.

**Underwater Hull Areas & Running Gear:**

The underwater areas were not inspected during this survey.

All of the running gear was not inspected during this survey.

**Topsides:**

All of the topsides were inspected from the dock only and found good with no dings or scrapes noted. The swim platform is integral on the transom and was found good.

**Exterior:**

The vessel comes with the standard layout and as listed previously in this report was well found. All equipment was found in good condition. The side decks are small however there are safety rails securely installed on the house sides to make movement fore and aft easy. The anchor windlass was found securely installed on the centerline below a deck hatch.

**Aft Deck:**

The aft deck has large sunbed areas to port and starboard and easy access to a large swim platform. There is access to the engine room through a deck hatch below the starboard sunbed as well as from the swim platform port side hatch. There is a large storage locker to starboard on the swim platform. Forward on the centerline is the entrance to the salon and accommodation.

**Interior:**

The interior has recently been upgraded with a white 'Faux' leather finish.

The interior comes with the standard layout, which includes a good-sized salon that has good seating and storage. There is a large sofa to starboard with a wet bar and TV cabinet opposite to port.

**SURVEY REPORT FOR "COLUMBO"****Interior:**

The helm is forward to starboard. There is good access to all controls, gauges and electronics and visibility is adequate from this station. Opposite the helm on the port side is a large bench seat and chart table.

On the centerline a set of stairs lead forward to the lower accommodation area. The galley is to port and was found clean and neat with all equipment in good working condition.

The cabins were all found clean and neat with each head also found in good condition. The master cabin is forward and has a queen-sized bed on the centerline facing aft, with good storage below and in hanging lockers to port and starboard. Access to the separate stall shower and head is aft to starboard.

The port cabin comes with a queen sized bed facing forward and the head with separate stall shower which is forward can also be accessed from the companionway. There is good storage in hanging lockers and drawers throughout the cabin.

The aft cabin comes with two "L" configuration over-under single beds and the head with separate stall shower is starboard. There is good storage in hanging lockers and drawers throughout the cabin.

**Machinery Space:**

This area is accessed from the swim platform through a deck hatch and although headroom is limited there is good access to all of the machinery to carry out all service work. Both main engines started and ran well at the dock with the generator able to carry the entire vessels electrical load. There are no apparent leaks.

**MUST RECOMMENDATIONS:**

- ☒ Fire Extinguishers, Service and date tag.
- ☒ Clean agent system, Service and date tag.
- ☒ Flares, Purchase and store on board.
- ☒ USCG Plaques, Install plaques for oil pollution & garbage disposal.
- ☒ Bell, Purchase & install.
- ☒ Main engine and generator shutdowns, prove.
- ☒ Life ring, attach floating throw line.


5/16/2014

Page 15

**SURVEY REPORT FOR "COLUMBO"**

The above represents the opinion of the undersigned based on the facts presented and the discoveries made while surveying subject vessel, with no warranty either specific or implied being made.

Respectfully submitted,

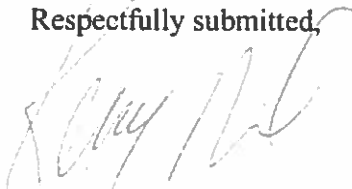

Kerry Nikula  
Attending surveyor  
Signed without prejudice  
May 16, 2014



# FLORIDA NAUTICAL SURVEYORS.

Marine Surveyors & Consultants

2727 NE 32<sup>nd</sup> Street  
Fort Lauderdale, FL 33306

Tel. (954) 801 2140  
(954) 630 2141  
Fax. (954) 630 8784

email: [FNSurveys@aol.com](mailto:FNSurveys@aol.com)

[www.FloridaNauticalSurveyors.com](http://www.FloridaNauticalSurveyors.com)

May 15, 2014



## CYL75011A696

HIN FOR 75' COLUMBO

### “NO NAME 75”